
## **BUCKINGHAM PRODUCT DATA SHEET**



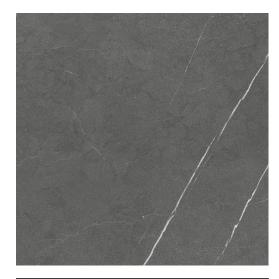

## **Available Sizes**

600x300x9mm 1200x600x9mm 900x450x9mm 2700x1200x6mm 600x600x9mm 900x900x9mm 1200x1200x9mm

## Samples Service

Tel: +44 (0) 1782 524 043 Fax: +44 (0) 1782 577 379 Email: samples@johnson-tiles.com

## Technical Helpline

Tel: +44 (0) 1782 524 111 Fax: +44 (0) 1782 577 379

Email: techadvice@johnson-tiles.com

www.johnson-tiles.com

	Up to 30%	
Range	Buckingham	
Category	Marble, Floor Tiles	
Collection	Absolute Collection	
Short Code	BUCK4B	
Colour	Anthracite	
Finish	Soft Bush Hammered	
Wall Suitability	Internal & External	
Floor Suitability	Internal Only	
Wet Barefoot	-	
Material	Porcelain	
Classificiation	Bla	
Light Reflectance Value	15.00	
CSV	V2	
PTV (96)	Wet 25-35 Dry 36+	
PTV (55)	-	
R Value	9	
Wet Ramp	А	
PEI	-	
Traffic	Commercial	

Physical Properties			
Test / Standard	Requirement	Test Result	
Length/Width EN ISO 10545-2	±0.6%≤ ± 2mm	Pass	
Thickness EN ISO 10545-2	±5%≤ ± 0.5mm	Pass	
Straightness of Sides EN ISO 10545-2	±0.5% ≤ ± 1.5mm	Pass	
Rectangularity EN ISO 10545-2	±0.5% ≤ ± 2mm	Pass	
Surface Flatness EN ISO 10545-2	±0.5% ≤ ± 2mm	Pass	
Water Absorption EN ISO 10545-3	≤0.5%	≤0.1%	
Modulus of Rupture EN ISO 10545-4	≥35N/mm²	≥55N/mm²	
Abrasion Resistance EN ISO 10545-6	≤175mm³	<109mm³	
Thermal Shock EN ISO 10545-9	Pass	Pass	
Frost Resistance EN ISO 10545-12	Resistant	Resistant	
Chemical Resistance EN ISO 10545-13	Min Class B	Class A	
Stain Resistance EN ISO 10545-14	Min Class 3	Class 5	
Fire Rating Not Applicable	N/A	Class A I FL Non Combustible	
Weight/m² Thickness: 9mm		21kg	

Tile colours shown of the tile product on this data sheet are as accurate as the limitations of the printing process will allow. Due to the manufacturing process of all floor tiles there may be sm resistance. The slip resistance values provided are accurate at the time of testing and represent the standard production value. Please note, inadequate cleaning and maintenance will lead to a standard production value. Please note, inadequate cleaning and maintenance will lead to a standard production value. Please note, inadequate cleaning and maintenance will lead to a standard production value.

